

# OPERATORS' MANUAL

## Inverter DC MMA Arc Welding Machine

ISO9001:2000

# *SANSTICK 160S*

# SanRex

**IMPORTANT: Read this Owner's Manual Completely** before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection. Contact your distributor if you do not fully understand this manual.

2018.7.6

## INTRODUCTION

### **Welcome to use our products!**

Welding is not only technology, but also a kind of art. Since

Up to now, our company has gotten the certificate of ISO9001 Quality Management System, CCC and CE Approval. It has possessed the several intellect property rights and the advanced technology Research Centre. We are also an Enterprise R&D Center authorized by Shanghai Pudong New Area government.

Its products have been obtained many national patents and the Enterprise Innovation Fund from State Science and Technology Bureau. Based on developing the inverter technology, our digital control welders were assessed as a changing item of the achievements in scientific research and patent secondary developing item by Shanghai Science and Technology Community.

Its products have being used widely in the field of Ship-building, Electric Power-plant, Petrochemical, Nuclear Power-plant, Automobile, Steel Structure, Light Industry and etc. There are 35 branches and exclusive agencies distributing all of the country. Our products have been exported to Occident and East and South of Asia.

The main products are as follows:

**ZX7** series inverter DC MMA

**WS** series inverter DC TIG/MMA

**WSM** series inverter DC pulse TIG/MMA

**WSME** series inverter AC/DC pulse TIG/MMA

**NB** series inverter MIG/MAG

**NBC** series step-control MIG/MAG

**MZ** series inverter automatic submerged arc welders

**LG** series inverter plasma cutter

**Digital** control welders

**Heat pipe radiator, Plating power source, Transformer and Special purposed welding equipment**

We will keep to the quality policy: **Customer Uppermost, Quality Fundament, Arc Twinkle and Welding Durable**, and provide the best service for all of our customers!

# CONTENT

|  |           |
|--|-----------|
| <b>§1 SAFETY .....</b>                                   | <b>1</b>  |
| §1.1 SIGNAL EXPLANATION.....                             | 1         |
| §1.2 ARC WELDING DAMAGE .....                            | 1         |
| §1.3 THE KNOWLEDGE OF ELECTRIC AND MAGNETIC FIELDS ..... | 4         |
| <b>§2 SUMMARY .....</b>                                  | <b>5</b>  |
| §2.1 BRIEF INTRODUCTION .....                            | 5         |
| §2.2 WORKING PRINCIPLE.....                              | 6         |
| §2.3 VOLT-AMPERE CHARACTERISTIC .....                    | 6         |
| <b>§3 INSTALLATION &amp; ADJUSTMENT.....</b>             | <b>7</b>  |
| <b>§3.1 PARAMETERS .....</b>                             | <b>7</b>  |
| §3.2 DUTY CYCLE & OVER HEAT.....                         | 7         |
| §3.3 WELDING POLARITY CONNECTION WAY .....               | 8         |
| §3.3.1 MMA .....   | 8         |
| §3.3.2 TIG .....   | 8         |
| <b>§4 OPERATION CONTROL AND CONNECTORS.....</b>          | <b>10</b> |
| §4.1 LAYOUT FOR FRONT & REAR PANEL .....                 | 10        |
| §4.3 WELDING OPERATION .....                             | 11        |
| §4.3.1 <i>Striking arc way</i> .....                     | 11        |
| §4.3.2 <i>Manipulation of electrode</i> .....            | 11        |
| §4.4 WELDING PARAMETERS .....                            | 12        |
| §4.4.1 <i>Joint form in MMA</i> .....                    | 12        |
| §4.4.2 <i>Electrode selection</i> .....                  | 12        |
| §4.5 ARC WELDING DEFECT AND PREVENT METHOD .....         | 13        |
| §4.6 OPERATION ENVIRONMENT .....                         | 14        |
| §4.7 OPERATION NOTICES.....                              | 14        |
| <b>§5 MAINTENANCE &amp; TROUBLESHOOTING .....</b>        | <b>16</b> |
| §5.1 MAINTENANCE .....                                   | 16        |
| §5.2 TROUBLESHOOTING.....                                | 17        |
| §5.3 ELECTRICAL PRINCIPLE DRAWING .....                  | 19        |

# § 1 SAFETY


## §1.1 Signal Explanation



• The above signals mean warning! Notice! Running parts and getting an electric shock or thermal parts will take damage for your body or others. The corresponding notices are as follows. It is quite a safe operation after taking several necessary protection measures.

## §1.2 Arc Welding Damage

- The following signals and word explanations are to some damages for your body or others happening on the welding operation. While seeing these, please remind of yourself or others to be dangerous.
- Only ones who are trained professionally can install, debug, operate, maintain and repair the equipment.
- During the operation, non-concerned people should be lift, especially for children.
- After shut off the machine power, please maintain and examine the equipment according to §5 because of the DC voltage existing in the electrolytic capacitors.

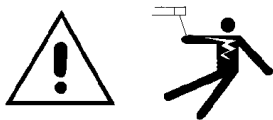

### **ELECTRIC SHOCK CAN KILL.**

- Never touch electrical parts.
- Wear dry, hole-free gloves and clothes to insulate yourself.
- Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.
- Take carefully when using the equipment in small place, falling-off and wet circumstance.
- Never close the machine power before installation and adjustment.
- Ensure to install the equipment correctly and ground the work or metal to be welded to a good electrical (earth) ground according to the operation manual.
- The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.

- In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically “hot”.
- Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- Never dip the electrode in water for cooling.
- Never simultaneously touch electrically “hot” parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.



### **FUMES AND GASES CAN BE DANGEROUS.**

- Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. When welding with electrodes which require special ventilation such as stainless or hard facing or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and below Threshold Limit Values using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.
- Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- Read and understand the manufacturer’s instructions for this equipment and the consumables to be used, including the material safety data sheet and follow your employer’s safety practices.



### **ARC RAYS CAN BURN.**

- Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding.
- Use suitable clothing made from durable flame-resistant material to protect your skin and that

of your helpers from the arc rays.

- Protect other nearby personnel with suitable, non-flammable screening and /or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



### SELF-PROTECTION

- Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.
- Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.



**DO NOT** add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.



### WELDING SPARKS can cause fire or explosion.

- Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.
- Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situation.
- When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been “cleaned”.
- Vent hollow castings or containers before heating, cutting or welding. They may explode.
- Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuff less trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.

- Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.



### **Rotating parts may be dangerous.**

- Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.
- Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- Cylinders should be located:
  - Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- Never allow the electrode, electrode holder or any other electrically “hot” parts to touch a cylinder.
- Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.

## **§1.3 The knowledge of Electric and Magnetic Fields**

Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). The discuss on the effect of EMF is ongoing all the world. Up to now, no material evidences show that EMF may have effects on health. However, the research on damage of EMF is still ongoing. Before any conclusion, we should minimize exposure to EMF as few as possible.

In order to minimize EMF, we should use the following procedures:

- Route the electrode and work cables together – Secure them with tape when possible.
- All cables should be put away and far from the operator.
- Never coil the power cable around your body.
- Make sure welding machine and power cable to be far away from the operator as far as possible according to the actual circumstance.
- Connect the work cable to the workpiece as close as possible to the area being welded.
- The people with heart-pacemaker should be away from the welding arc.

## § 2 Summary

This operation manual is suitable for the models of SANSTICK 160S

### §2.1 Brief Introduction

SANSTICK 160S welder is general MMA arc welder which adopts the latest pulse width modulation (PWM) technology and the insulated gate bipolar transistor (IGBT) power module. It can change work frequency to medium frequency so as to replace the traditional hulking work frequency transformer with the cabinet medium frequency transformer. Thus, it is characterized with portable, small size, low consumption and etc.

SANSTICK 160S has excellent performances: constant current output makes welding arc more stable; fast dynamic response speed reduces the impact from the arc length fluctuation to the current; accurate stepless current adjustment and pre-setting function. There are also some automatic protection functions for under voltage, over current, over heat, etc. inside the welders, when the problems listed before occurred, the alarm on the front panel is light and at the same time the output current will be cut off. It can self-protect and prolong the using life and greatly improved the reliability and practicability of the welders.

SANSTICK 160S welder can also realize TIG operation. While MMA operation, if the electrode touches workpiece over two seconds, the welding current will drop to the minimum current automatically to protect the electrode. While TIG operation, the minimum current will be outputted firstly until the arc is ignited by lifting method, the output current will rise to the preset value, which can protect the electrode. At the same time, the arc force and hot start will be provided with MMA operation.

MMA——Manual Metal Arc welding;

PWM——Pulse-Width Modulation;


IGBT——Insulation Gate Bipolar Transistor;

TIG——Tungsten Inert Gas welding.



## §2.2 Working Principle


The working principle of SANSTICK 160S welder is shown as the following figure. Single phase 120V–240V±10% work frequency (50/60 Hz) AC is rectified into DC, then by PFC circuit, DC(about 380V)is converted to medium frequency AC (about 40KHz) by inverter device (IGBT module), after reducing voltage by medium transformer (the main transformer) and rectified by medium frequency rectifier (fast recovery diodes), and is outputted by inductance filtering. The circuit adopts current feedback control technology to insure current output stably. Meanwhile, the welding current parameter can be adjusted continuously and steplessly to meet with the requirements of welding craft.

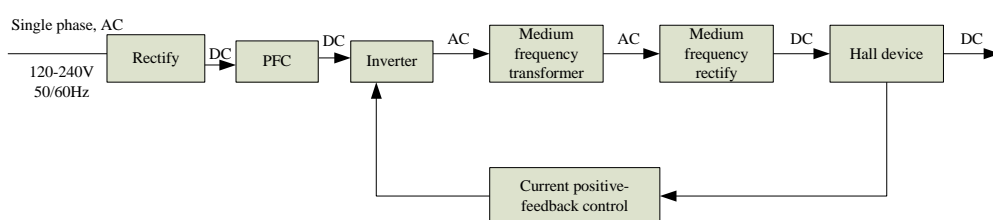

## §2.3 Volt-Ampere Characteristic

SANSTICK 160S welder has excellent volt-ampere characteristic, seeing the following graph. In MMA welding, the relation between the rated loading voltage  $U_2$  and welding current  $I_2$  is as follows:

When  $I_2 \leq 600A$ ,  $U_2 = 20 + 0.04 I_2$  (V); When  $I_2 > 600A$ ,  $U_2 = 44$  (V) .

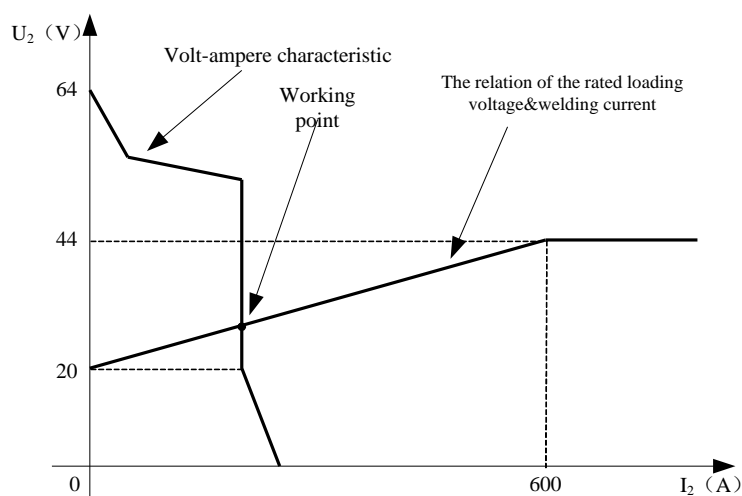

## § 3 Installation & Adjustment

### §3.1 Parameters


| Parameters                                 | Models                          |                      |                                   |      |
|--|---------------------------------|----------------------|-----------------------------------|------|
|  | SANSTICK 160S                   |                      |                                   |      |
| Input power                                | 1~120V±10%, 50/60Hz             |                      | 1~240V±10%, 50/60Hz               |      |
|  | TIG                             | MMA                  | TIG                               | MMA  |
| Rated input current (A)                    | 19.5                            | 31.8                 | 13.2                              | 20.4 |
| Rated input power (KW)                     | 2.2                             | 3.8                  | 3.1                               | 4.7  |
| Power factor                               | 0.99                            |                      | 0.99                              |      |
| Welding current range (A)                  | 10~125                          |                      | 10~160                            |      |
| Max no-load voltage(V)                     | 55(80)                          |                      |                                   |      |
| Efficiency                                 | ≥80%                            |                      | ≥80%                              |      |
| Duty cycle (40 °C, 10 minutes), see § 3.2) | 30% 125A<br>60% 95A<br>100% 75A | 60% 125A<br>100% 90A | 40% 160A<br>60% 125A<br>100% 100A |      |
| Protection class                           | IP23                            |                      |                                   |      |
| Insulation class                           | F                               |                      |                                   |      |
| Dimensions of Machine (L×W×H) (mm)         | 365×140×230                     |                      |                                   |      |
| Weight (Kg)                                | 8                               |                      |                                   |      |

Note: The above parameters are subject to change with the improvement of machines.

### §3.2 Duty cycle & Over heat

The letter “X” stands for duty cycle, which is defined as the proportion of the time that a machine can work continuously within a certain time (10 minutes). The rated duty cycle means the proportion of the time that a machine can work continuously within 10 minutes when it outputs the rated welding current.


The relation between the duty cycle “X” and the output welding current “I” is shown as the right figure.

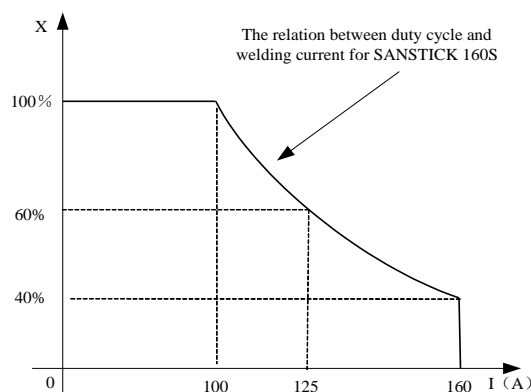


If the welder is over-heat, the IGBT over-heat protection unit inside it will output an instruction to cut output welding current, and brighten the over-heat pilot lamp on the front panel. At this time, the machine should be relaxed for 15 minutes to cool the fan. When operating the machine again, the welding output current or the duty cycle should be reduced.

## § 3.3 Welding polarity connection way

### §3.3.1 MMA

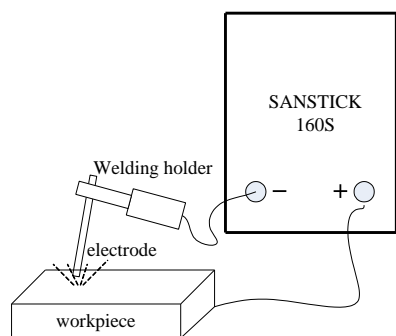


DCEN

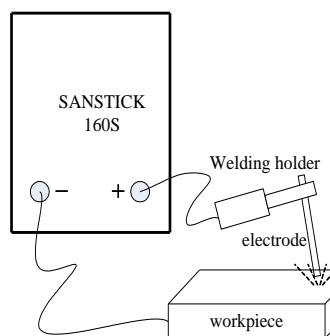

DCEP


Choosing the connection of DCEN or DCEP is based on the arc stable burning condition. The different electrodes need different connection way. Please refer to the electrode manual.

### §3.3.2 TIG

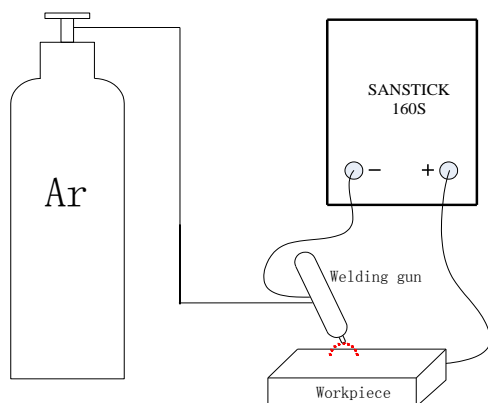

DCEN

- When TIG operation, the shielded gas is inputted to welding gun directly, and the method of lifting arc is scraping arc.

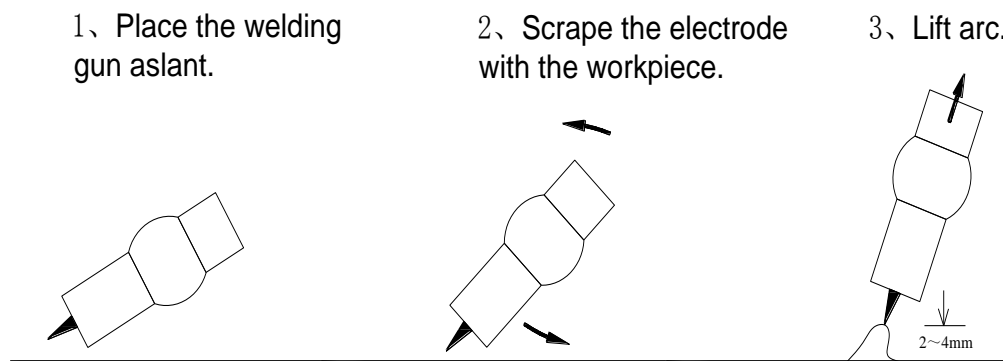


Steps of scraping arc

Stricking arc of TIG operation: when tungsten electrode touches the workpiece, the short-circuit current is only 28A . After generating arc, current can rise to the setting welding current.If the tungsten electrode touches the workpiece when welding, the current will drop to 5A within 2s, which can reduce the tungsten spoilage farthestly, prolong the using life of the tungsten electrode, and prevent tungsten clipping.

## § 4 Operation control and connectors


### § 4.1 Layout for front & rear panel

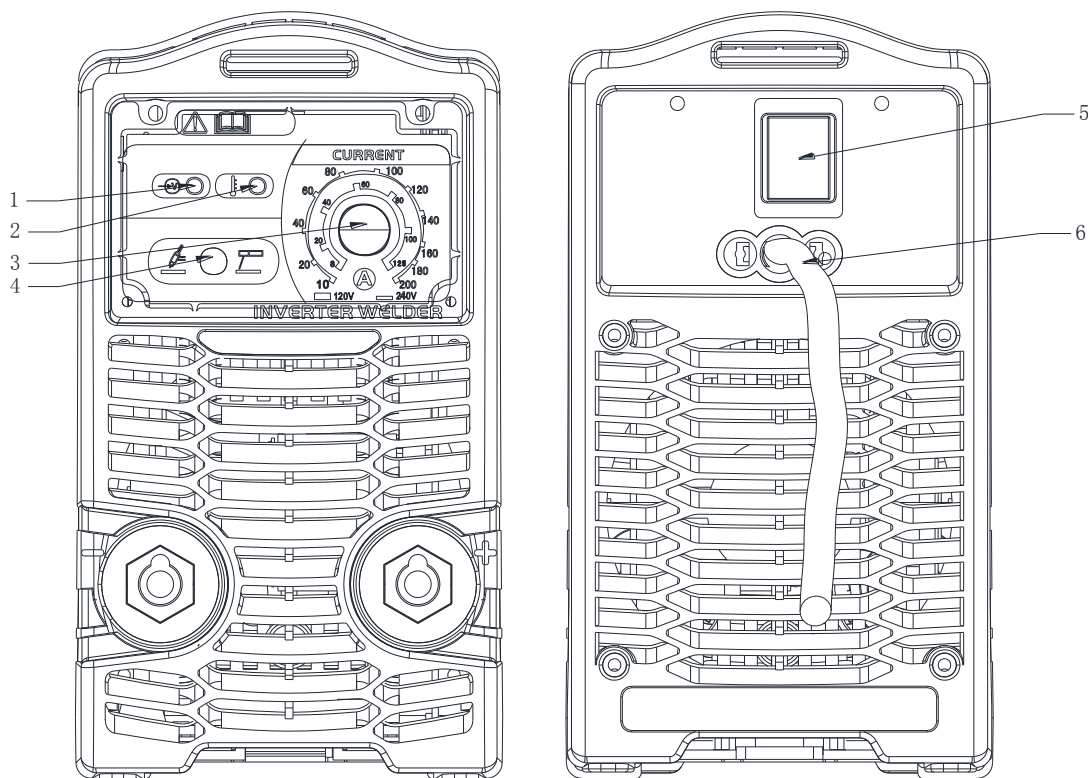

SANSTICK 160S

- |   |                            |  |
|---|----------------------------|--|
| 1 | Power pilot lamp           | This pilot lamp when lit indicates that the machine is on  |
| 2 | Alarm pilot lamp           | When the machine less voltage, over current, or over heat, This pilot lamp indicates when lit that the protection of the machine has been activated. |
| 3 | Welding current regulation | Set welding current<br>(240V: 10-160A; 120V: 10-125A)  |
| 4 | Conversion switch          | Choose (right), MMA<br>Choose (left), TIG  |
| 5 | Power Switch               | Choose "ON", power through;<br>Choose "OFF", power cut off.  |
| 6 | Cable clamp                | Fastened the mains cable   |

## § 4.2 Welding current adjustment

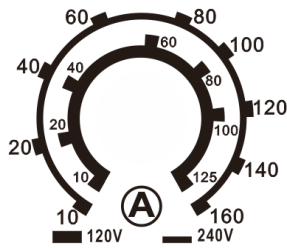


Welding current range : input120V:10 ~ 125A;  
input240V:10~160A。

SANSTICK 160S welder has the function of welding current pre-setting. It is convenient to set parameters and adjust accurately.


## §4.3 Welding operation

### §4.3.1 Striking arc way

- Knocking arc: take the electrode upright to touch the workpiece, after forming short circuit, quickly lift up about 2~4 mm, and arc will be ignited. This method is difficult to master. But in the welding for the brittle or hard steel, it is better to use knocking way.

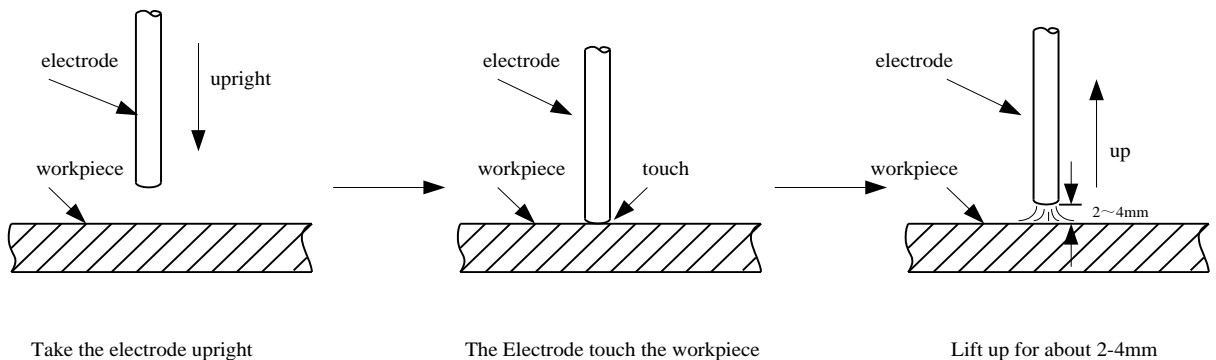

- Lifting arc: take the electrode to scrape the workpiece for striking arc. But it may cause the arc scratch, so must to lift arc in the groove.

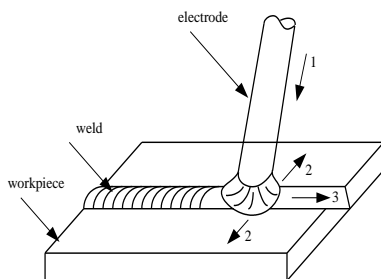

1-electrode moving; 2-the electrode swing right & left; 3-the electrode move along weld

### §4.3.2 Manipulation of electrode

In MMA welding, there are three motions to be matched in the end of electrode: the electrode moving to the molten pool along axes; the electrode swing right and left; the

electrode moving along welding way.


The operator can choose the manipulation of electrode based on welding joint shape, welding position, electrode spec, welding current and operation skill, etc.

The details please refer to 《Welding Dictionary》 P69, Volume 1 of Edition 2.

## §4.4 Welding parameters

### §4.4.1 Joint form in MMA

In MMA welding, the common basic joint form: butt joint, lap joint, corner joint & T joint.

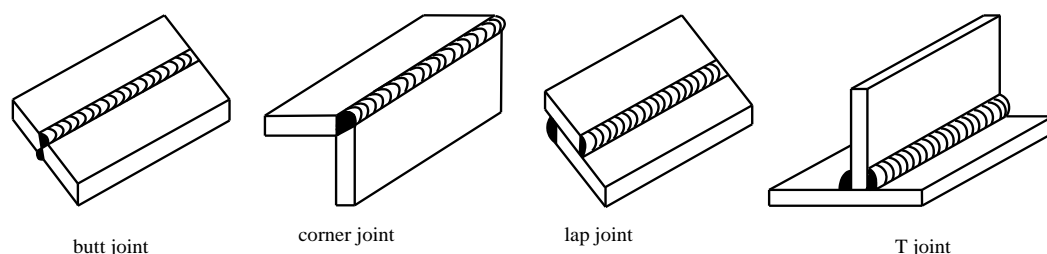

### §4.4.2 Electrode selection

The electrode diameter selection is based on the workpiece thickness, welding position, joint form, welding layer, etc. Please refer to the following table.

| The welding current reference for different electrode diameter   |       |       |       |         |
|--|-------|-------|-------|---------|
| Electrode diameter/mm  | 1.6   | 2.0   | 2.5   | 3.2     |
| Welding current/A  | 25~40 | 40~60 | 50~80 | 100~130 |
| The relation between the welding current(I)' factor(K) & electrode diameter(d) (I=K×d: Carbon electrode) |       |       |       |         |
| Electrode diameter/mm  | 1.6   | 2~2.5 | 3.2   |         |
| Factor/K   | 20~25 | 25~30 | 30~40 |         |

Notice: the above parameters originate from 《Welding Dictionary》 P66~P67, Volume 1 of Edition 2.

- Electrode should be drying according to user manual before using. For reducing the hydrogen of the molten pool and welding seam, and avoiding the blowhole and cold crack.

- In the welding process, the arc must not be too long; otherwise, it will cause unstable arc burning, large spatter, light penetration, undercut, blowhole, etc. If the arc is too short, it will cause electrode stick.
- In MMA welding the arc length is usually equal to 0.5~1.0 time of the electrode diameter. The basic electrode's arc length is not beyond the electrode diameter, it's better to choose the short arc welding; the acid electrode's arc length is equal to the electrode diameter.

### §4.5 Arc Welding Defect and Prevent Method

| Defect name                               | Caused reasons  | Prevent methods   |
|---|---|---|
| Welding seam doesn't meet the requirement | The groove angle is not proper<br>The root face and assembly gap is not equal<br>Welding technics parameters are unreasonable<br>The welder's operation skill is lower  | Choosing the proper groove angle & assembly gap, improve the assembly quality<br>Choosing the proper welding parameters<br>Improve the operation skill of welders   |
| Undercut                                  | Over current<br>Arc length is too long<br>The electrode angle is wrong<br>Manipulation of electrode is not proper   | Choosing the proper welding current & speed<br>The arc can't be drawn too long<br>The electrode angle should be proper<br>Manipulation of electrode should be correct   |
| Incomplete penetration                    | The groove angle or gap is too small, the root face is too big<br>Welding parameters are not suitable, or the assembly is not good<br>The welder's operation skill is lower   | Correctly to choose and process the groove size<br>Correctly to assemble and ensure clearance<br>Choosing the suitable welding current & speed<br>Improve the operation skill of welders  |
| Incomplete fusion                         | The welding thermal input is too low<br>The arc direction is lean<br>There are rust & dust on the side of groove<br>The slag between the layers is not cleared well   | Correctly to choose the welding parameters<br>Operation seriously<br>Enhance the clearness of layers  |
| Overlap                                   | The temperature of molten pool is too high<br>The liquid metal concretes slowly   | Choosing parameters based on the welding different position<br>Strictly to control the molten hole size   |
| Crater                                    | The crater time lasts too short<br>Over current in the welding of thin plate  | In the crater, electrode should be stayed for a short time or round to manipulate electrode after the molten pool is filled in by metal, take to the side for crater  |
| Blowhole                                  | There are some dust like oil, rust or water on the work piece surface and groove<br>The coating of electrode is damped& is not drying<br>Under current or over speed in the welding<br>The arc is too long or lean burning, the molten pool protection is not good<br>Over current, the coating of electrode falls off and lose protection<br>Manipulation of electrode is not proper | Clear out the dust around groove for about 20~30mm<br>Strictly to dry the electrode according to manual<br>Correctly to choose parameters and to operate<br>Using the short arc operation<br>Welding operation in the field should have anti-wind protection<br>Don't use the invalid electrode |
| Inclusion & slag inclusion                | The slag clears bad in the middle layer in the welding process<br>Under current or over speed in the welding<br>Welding operation is not proper<br>The welding material can not match the work piece<br>The groove design & processing are not proper   | Choosing the electrode of good slag detachability<br>Strictly to clear the slag in the layers<br>Correctly to choose the welding parameters<br>Adjusting the electrode angle and manipulation way   |



|            |   |   |
|------------|---|---|
| Hot crack  | In the process of solidification, the inter crystal segregation is seriously caused. At the same time, with the effect of welding stress, the hot crack is formed.                  | Strictly control the percentage of S and P in welding material.<br>Adjust the structure of welding material.<br>Adopt the basic electrode.  |
| Cold crack | Three reasons will cause cold crack:<br>The structure turned from the marten site<br>The residual stress caused by big restraint intensity<br>The residual hydrogen in welding gap. | Adopt low hydrogen type basic electrode.<br>Bake under the instruction before use.<br>Remove the feculence before use, reduce the percentage of hydrogen<br>Adopt appropriate parameters and heat input<br>After welding, do dehydrogenation at once. |

## §4.6 Operation Environment

- Height above sea level is below 1000m.
- Operation temperature range:-10<sup>0</sup>C~+40<sup>0</sup>C.
- Relative humidity is below 90 %(+20<sup>0</sup>C).
- Preferably site the machine some angles above the floor level, the maximum angle does not exceed 15<sup>0</sup>.
- Protect the machine against heavy rain or in hot circumstance against direct sunshine.
- The content of dust, acid, corrosive gas in the surrounding air or substance can not exceed normal standard.
- Take care that there is sufficient ventilation during welding. There is at least 30cm free distance between the machine and wall.

## §4.7 Operation Notices

- Read §1 carefully before attempting to use this equipment.
- Connect the ground wire with the machine directly
- In case closing the power switch, no-load voltage may be exported. Do not touch the output electrode with any part of your body.
- Before operation, no concerned people should be left. Do not watch the arc in unprotected eyes.
- Ensure good ventilation of the machine to improve duty ratio.
- Turn off the engine when the operation finished to economize energy sources.
- When power switch shuts off protectively because of failure. Don't restart it until problem is resolved. Otherwise, the range of problem will be extended.
- In case of problems, contact your local dealer if no our authorized maintenance man.

## § 5 Maintenance & Troubleshooting

### §5.1 Maintenance

In order to guarantee that arc welding machine works high-efficiently and in safety, it must be maintained regularly. Let customers understand the maintenance methods and means of arc welding machine more , enable customers to carry on simple examination and safeguarding by oneself, try one's best to reduce the fault rate and repair times of arc welding machine, so as to lengthen service life of arc welding machine .Maintenance items in detail are in the following table.

- **Warning: For safety while maintaining the machine, please shut off the supply power and wait for 3 minutes, until capacity voltage already drops to safe voltage 36V.**

| Date                | Maintenance items   |
|---------------------|---|
| Daily examination   | <p>Observe that whether panel knob and switch in the front and at the back of arc welding machine are flexible and put correctly in place. If the knob has not been put correctly in place, please correct; If you can't correct or fix the knob , please replace immediately;</p> <p>If the switch is not flexible or it can't be put correctly in place, please replace immediately; Please get in touch with our company maintenance service department if there are no accessories.</p> <p>After turn-on power, watch/listen to that whether the arc welding machine has shaking, whistle calling or peculiar smell. If there is one of the above problems, find out the reason to get rid of; if you can't find out the reason, Please contact local this area our company agent or the branch company.</p> <p>Observe that whether the display value of LED is intact. If the display number is not intact, please replace the damaged LED. If it still doesn't work, please maintain or replace the display PCB.</p> <p>Observe that whether the min/max value on LED accords with the set value. If there is any difference and it has affected the normal welding craft, please adjust it.</p> <p>Check up that Whether fan is damaged and is normal to rotate or control. If the fan is damaged, please change immediately. If the fan does not rotate after the arc welding machine is overheated , observe that whether there is something blocked in the blade, if it is blocked, please get rid of ; If the fan does not rotate after getting rid of the above problems, you can poke the blade by the rotation direction of fan. If the fan rotates normally, the start capacity should be replaced; If not, change the fan.</p> <p>Observe that whether the fast connector is loose or overheated. if the arc welding machine has the above problems, it should be fastened or changed.</p> <p>Observe that Whether the current output cable is damaged. If it is damaged, it should be wrapped up, insulated or changed.</p> |
| Monthly examination | <p>Using the dry compressed air to clear the inside of arc welding machine. Especially for clearing up the dusts on radiator, main voltage transformer, inductance, IGBT module, the fast recover diode and PCB, etc.</p>   |

|                            |   |
|----------------------------|---|
|                            | Check up the bolt in arc welding machine, if it is loose, please screw down it. If it is skid, please replace. If it is rusty, please erase rust on bolt to ensure it works well.                     |
| Quarter-yearly examination | Whether the actual current accords with the displaying value. If they does not accord, they should be regulated. The actual current value can be measured by the adjusted plier-type ampere meter.    |
| Yearly examination         | Measure the insulating impedance among the main circuit, PCB and case, if it below $1M \Omega$ , insulation is thought to be damaged and need to change, and need to change or strengthen insulation. |

### § 5.2 Troubleshooting

- Before arc welding machines are dispatched from the factory, they have already been debugged accurately. So forbid anyone who is not authorized by our company to do any change to the equipment!
- Maintenance course must be operated carefully. If any wire becomes flexible or is misplaced, it maybe potential danger to user!
- Only professional maintenance personal who is authorized by our company could overhaul the machine!
- Guarantee to shut off the arc welding machine's power before turn on the outline of the equipment!
- If there is any problem and has no the authorized professional maintenance personal of our company, please contact local our company agent or the branch company!

If there are some simple troubles of welding machines, you can consult the following overhauling chart:

| S/N  | Troubles  | Reasons  | Solutions  |  |
|--|---|--|--|--|
| 1  | Turn on the power source, and fan works, but the power light is not on.       | The power light damaged or connection is not good                                      | Test and repair the inside circuit of power light Pr3          |  |
|  |   | Power PCB failures   | Repair or change power PCB Pr2                                 |  |
| 2  | Turn on the power source, and the power light is on, but fan doesn't work     | There is something in the fan  | Clear out  |  |
|  |   | The fan motor damaged  | Change fan motor   |  |
| 3  | Turn on the power source, and the power light is not on, and fan doesn't work | No input voltage   | Check whether there is input voltage                           |  |
|  |   | Overvoltage (Input voltage is too much or not)   | Check input voltage  |  |
| 4  | No no-load voltage output   | There is trouble inside the machine  | Check the main circuit, Pr1 and Pr2                            |  |
| 5  | No current output in the welding  | Welding cable is not connected with the two output of the welder.                      | Connect the welding cable to the welder's output               |  |
|  |   | Welding cable is broken  | Wrap, repair or change the welding cable                       |  |
|  |   | Earth cable is not connected or loosen   | Check the earth clamp  |  |
| 6  | Not easy to start arc in the welding, or easy to cause sticking               | The plug loosen or connect not well  | Check and tighten the plug                                     |  |
|  |   | Oil or dust covered the workpiece  | Check and clear out  |  |
|  |   | MMA/TIG welding selection is wrong   | Selecting the MMA welding                                      |  |
| 7  | The arc is not stable in the welding process                                  | The arc force is too small   | Increase the arc force   |  |
| 8  | The welding current can not be adjusted                                       | The welding current potentiometer in the front panel connection not so good or damaged | Repair or change the potentiometer                             |  |
| 9  | The penetration of molten pool is not enough(MMA)                             | The welding current adjusted too low   | Increase the welding current                                   |  |
|  |   | The arc force adjusted too small   | Increase the arc force   |  |
| 10   | Arc blow  | Airflow disturbance  | Use the shelter from airflow                                   |  |
|  |   | The electrode eccentricity   | Adjust the electrode angle                                     |  |
|  |   |  | Change the electrode   |  |
|  |   | Magnetic effect  | Incline the electrode to the opposite way of the magnetic blow |  |
| Change the position of earth clamp or add earth cable in the two side of workpiece |   |  |  |  |
| 11   | The alarm light is on   | Over heat protection   | Over welding current   |  |
|  |   | Over current protection  | Working time too long  | Induce the duty cycle (interval work)                |
|  |   |  | Unusual current in the main circuit                            | Test and repair the main circuit and drive PCB (Pr1) |

## §5.3 Electrical principle drawing

